PAGE: 1

PRINT DATE: 06/08/90

505D25QL ATTACHMENT -Page 60 of 152

FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CRITICAL HARDWARE

NUMBER: MD-AA2-350-X

SUBSYSTEM NAME: STABILIZED PAYLOAD DEPLOYMENT SYSTEM

REVISION: 2 06/08/90

PART NAME YENDOR KAME

PART NUMBER VENDOR NUMBER

ASSEM :

PANEL A7A3

V790-773001

■ SRU

DIODE

JANTXV1N4246

PART DATA

EXTENDED DESCRIPTION OF PART UNDER ANALYSIS:

REFERENCE DESIGNATORS:

36V73A7A3-A2CR1 36V73A7A3-A2CR2 36V73A7A3-A2CR3 36V73A7A3-A3CR1 36V73A7A3-A3CR2

36V73A7A3-A3CR3

■ QUANTITY OF LIKE ITEMS: 6

FUNCTION:

PROVIDES BUS ISOLATION BETWEEN MAIN DC BUS A AND MAIN DC BUS B. ALLOWS SWITCH S3 OR S4 TO SIMULTAMEOUSLY EMERGIZE ALL PIC'S WHILE MAINTAINING BUS INTEGRITY.

PRINT DATE: 06/08/90 SOSOZSOL ATTACHMENT -PAGE: Page &T of 152 FAILURE MODES EFFECTS ANALYSIS (FMEA) — CRITICAL FAILURE MODE NUMBER: MO-AA2-350-02 REVISION# 2 05/08/90 SUBSYSTEM: STABILIZED PAYLOAD DEPLOYMENT SYSTEM CRITICALITY OF THIS ITEM NAME: DIODE FAILURE MODE: 2R3 = FAILURE MODE: SHORTED MISSION PHASE: ON-DRBIT ■ VEHICLE/PAYLOAD/KIT EFFECTIVITY: 102 COLUMBIA 2 103 DISCOVERY : 104 ATLANTIS : 105 ENDEAVOUR CAUSE: STRUCTURAL FAILURE; VIBRATION: CONTAMINATION: MECHANICAL, ELECTRICAL. THERMAL STRESS: PROCESSING ANOMALY. ■ CRITICALITY 1/1 DURING INTACT ABORT ONLY? N · REDUNDANCY SCREEN A) PASS B) FAIL C) PASS PASS/FAIL RATIONALE: PRELAUNCH CHECKOUT THE SHORTED DIGGE DOES NOT AFFECT FIRE COMMAND CAPABILITY. PHYSICAL AND ELECTRICAL ISOLATION OF REDUNDANT ELEMENTS. - FAILURE EFFECTS -(A) SUBSYSTEM: LOSS OF BUS ISOLATION WHEN FIRE SWITCHES ARE "ON". (B) INTERFACING SUBSYSTEM(S): UNDER ADVERSE BUS VOLTAGE CONDITIONS AND DUAL FIRE COMMANDS, THERE WILL SE CURRENT FLOW SETWEEN MN A AND MN B POSSIBLY CAUSING A FUSE TO OPEN

PAGE:

PRINT DATE: 06/08/90

S050250L ATTACHMENT -Page 82 of 152

FAILURE MODES EFFECTS AMALYSIS (FMEA) — CRITICAL FAILURE MODE

NUMBER: NO-AA2-350-02

IN THE ASSOCIATED "FIRE" COMMAND CIRCUIT. RESULTING IN LOSS OF REDUNDANT PIC FIRE COMMAD.

- (C) MISSION: NO EFFECT.
- (D) CREW, VEHICLE, AND ELEMENT(S): NO EFFECT.
- (E) FUNCTIONAL CRITICALITY EFFECTS:
 MULTIPLE FAILURE WOULD BE REQUIRED TO CAUSE LOSS OF PRIMARY TO SECONDARY PEDESTAL TRANSFER ACTIVATION REDUNDANCY.

- DISPOSITION RATIONALE -

- APPROVALS -

- (A) DESIGN: REFER TO APPENDIX F, ITEM 3.
- (8) TEST: REFER TO APPENDIX F. ITEM 3.
- (C) INSPECTION: REFER TO APPENDIX F. ITEM 3.
- # (0) FAILURE HISTORY: REFER TO APPENDIX F, ITEM 3.
- (E) OPERATIONAL USE: NONE

RELIABILITY ENGINEERING: W. R. MARLONE DESIGN ENGINEERING : T. TAUFER QUALITY ENGINEERING : M. F. MERGEN : MASA RELIABILITY : G.E : MASA SUBSYSTEM MANAGER :

MASA EPD&C RELIABILITY : MASA QUALITY ASSURANCE : MASA EPD&C SUBSYS MER :

MO-AA - 82